Configuration and Quick Start Guide VS-05 Smart Camera



Step 3 — Mount and Position the Camera


- 1. Place the camera and object in a location with as little ambient light as possible
- 2. Position the camera at a focal distance between 2" and 6" from the object.
- 3. Tip the camera relative to the object to avoid glare from specular reflection. Avoid excessive skew or pitch. Maximum skew is ±30°; maximum pitch is ±30°.

Proper lighting is critical to the success of a machine vision application. The VS-05 features integrated lighting (SXGA: built-in red LEDs @ 617nm; QXGA: built-in white LEDs). Depending on the requirements of your application, you may also need to add external lighting from di-soric's NERLITE family of machine vision lighting products.

Consider the following:

- Is the surface of the object flat, slightly bumpy, or very bumpy?
- Is the surface matte or shinv?
- Is the object curved or flat?
- · What is the color of the object or area being inspected?
- Is the object moving or stationary?

Machine vision lighting should maximize contrast of the areas or features being inspected while minimizing the contrast of everything else.

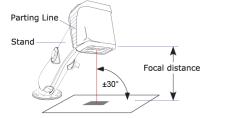

Camera / Object Positioning

Step 4 — Install di-soric AutoVision

AutoVision can be found on the di-soric Tools Drive that is packaged with the camera.



1. Follow the prompts to install VS AutoVision from the Tools Drive

- 2. Click on the VS AutoVision icon to run the program.
- Note: VS AutoVision can also be installed from the Download Center at www.di-soric.com


Minimum System Requirements

- Core2Duo processor
- · Windows 7 32-bit or XP operating system
- Internet Explorer 7 or higher
- 2GB RAM/128MB Video RAM (Windows 7); 1GB/128MB Video RAM (XP)
- 750MB to 1GB hard drive space
- 16-bit color display
- 3.0 Windows Experience Index (4.0 preferred)

Step 5 — Connect to the Camera


After you launch VS AutoVision, you will see the Select a device to start editing a job view. Note: If there is a default job on the camera, VS AutoVision will automatically skip the Connect step and you will see the **Image** view.


- 1. Select your camera from the Select Device dropdown menu.
- 2. Click the **Modify** button beneath the camera settings details to change camera settings.
- 3. Choose whether you want to create a new job, load a job (.avp) from your PC, or upload a job from the camera.

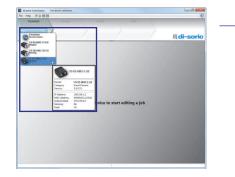


IP Address MAC Address Subnet Mask DHCP Memory Flash Modify

and set the desired Lighting Mode.

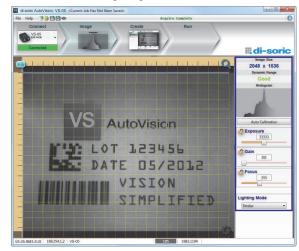

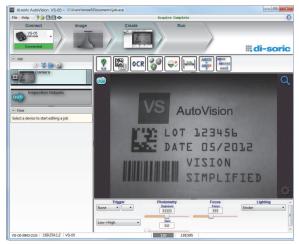

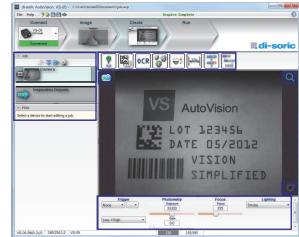


Step 1 — Check Hardware

The list of hardware below can be used in a variety of applications and configurations. Consult with di-soric for further information about which items are most appropriate for your application.

ltem	Description	Part Number
1	VS-05 Smart Camera	VS-05-BM3-X-US
2	Voltage Converter (to 10-28V)	VSID-A-24/5V-S
3	VSID-IB-S Interface Box	VSID-IB-S
5	Communication Cable (VSID-IB-S to Host, 6')	VSID-K-25S/9K-2
9	Power Supply (90-264 VAC, 24VDC, USA/Euro plug)	VSID-PS-IB

Step 2 — Connect the System

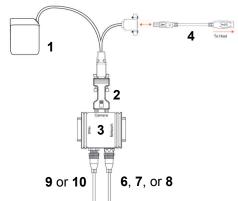

Hardware Configuration

- 1. Mount the camera (1) as required by the application.
- 2. Connect the USB side of the camera cable to the USB host cable (4).
- 3. Connect the VSID-A-24/5V-S (2) to the VSID-IB-S (3).
- 4. Connect the D-sub side of the camera cable to the VSID-A-24/5V-S (2).
- 5. Connect the trigger (6, 7, or 8) to the VSID-IB-S (3).
- 6. Connect the power supply (9 or 10) to the VSID-IB-S (3).
- 7. Plug in the power supply (9 or 10).

Step 6 — Evaluate a Captured Image and Auto Calibrate

You will see the Image view after selecting your device. This view allows you to evaluate your first image capture, providing information such as image size and a histogram. Click the Auto Calibration button to set optimal camera parameters automatically. You can also adjust Exposure, Gain, and Focus as needed,

Step 7 — Create Your First Job with VS AutoVision

After you have evaluated a captured image and Auto Calibrated the camera in the Image view, you will move to the Create view. This interface allows you to set camera parameters, add machine vision tools to captured images, set tool parameters, and configure I/O inspection outputs.


Step 8 — Explore the Interface

The Create view features a large image area with tool icons above and tool parameters below. When a tool is selected, its parameters appear below the image area.

Tools that have been added are shown in the job list to the left of the image area, below the Camera box. Image settings can be controlled using the icons in the corners of the image area

Step 9 — Set Camera Parameters

- 1. Click on the Camera box to the left of the image area.
- 2. In the camera parameters below the image area, select the desired type of Trigger, Trigger Polarity, Photometry (Exposure and Gain), Focus, and Lighting.

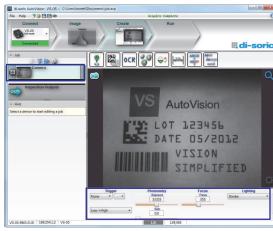

Step 10 — Add Tools to the Job

- 1. Click on the Decode Tool or drag it onto the image area.
- 2. Use the anchor points at the corners of the region of interest to form a box around the Data Matrix symbol. Leave plenty of space on each side of the symbol.
- 3. Now add a second Decode Tool and do the same for the 1D symbol below the Data Matrix symbol.
- 4. Finally, add an OCR Tool and drag the region of interest around the area of the image where "123456" is printed.



Step 11 — Try Out the Job

Once you have configured the tools as desired, use the arrow icons in the Job area to try the job you have just created.

Note: Most jobs will inspect multiple captured images. If only one image is being inspected, the effect of the arrow icons will not be evident.

Try Out Job

Try Out Job

in Loop


Once

X



Step 12 — Run the Job

When all job parameters are set, click on the Run step at the top of the interface. The software will download the vision job just created to the camera and will begin the inspection. Inspection results and the list of active tools are shown at the right of the image view. That information can also be moved below the image area by clicking the orientation buttons above the inspection results area.

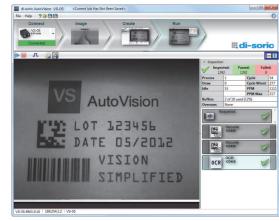

Test Jobs

Note: For descriptions of more advanced functionality, such as setting Inspection Outputs or using the Locate Tool and Decode Tool's Dynamic Locate functionality to track multiple tools from image to image, see the help documentation in AutoVision software.

Decode Tool, OCR Tool, Match Strings Tool, String Format Tool

LOT 123456 DATE 05/2012

VISION SIMPLIFIED

Measure Tool, **Count Tool**

Measure:

Measure the distance between the jaws of the caliper gauges at left.

Count: Count the circles on the dice shown at right.



Power Requirements and Pin Assignments

D-sub I/O Connector

Pin	Host RS-232	In/Out
1	Power +5VDC	In
2	TxD	Out
3	RxD	In
4	Power/Signal Ground	
5	NC	
6 7	NC	Out
	Output 1 TTL (Can sink 10mA and souce 10mA)	Out
8	Default configuration (activated by connecting pin 8 In to ground pin 4)	
9	Trigger	In
10	NC	In
11	Output 3 TTL (Can sink 10mA and souce 10mA)	Out
12	Input 1 (NPN)	In
13	Chassis ground (Connects chassis body to earth ground only. Do not use as power or signal return.)	
14	Output 2 TTL (Can sink 10mA and souce 10mA)	Out
15	NC	

VS-05 Smart Camera Accessories

Communication and I/C

VSID-A-24/5V-S Adapter

Interface

Communication Cable

Power Supply Power Supply


Mounting Options

Side Mount Bracket

Right-Angle Mirror Kit


SXGA Power Requirements: 5VDC +/- 5%, 200 mV p-p max. ripple, 465 mA @ 5VDC (typ.), 4.5 watts (max.)

VS-05 USB and I/O connectors

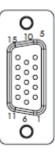

D-sub I/O Connector

USB Type B Connector

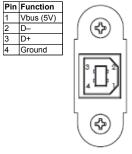

USB Type B Connector

O Devices and Cables				
er	VSID-A-24/5V-S	Connects the camera to an VSID-IB-S interface device. Provides 5VDC power and optoisolation for the camera.		
	VSID-IB-S	Allows cameras to be connected easily to power, trigger, and standard serial connections.		
	VSID-K-25S/9K-2	DB25 Plug to DB9 Socket, 6' (1829 mm)		
	VSID-PS-IB	90-264 VAC, 24VDC, USA/Euro plug		
	VSID-BW-001	Allows the camera to be mounted at a 90° angle.		
	VSID-R90-001	Changes field of view direction by 90°.		

Note: Additional accessories are available in the di-soric Product Pricing Catalog