

Pepperl+Fuchs Group www.pepperl-fuchs.com

USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com


Germany: +49 621 776 4411 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com


PEPPERL+FUCHS



Dimensions

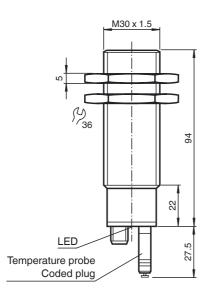

Electrical Connection



Core colors in accordance with EN 60947-5-2.

Pinout



Wire colors in accordance with EN 60947-5-2

| 1 | BN | (brown) |
|---|----|---------|
| 2 | WH | (white) |
| 3 | BU | (blue) |
| 4 | BK | (black) |
| 5 | GY | (gray) |

Possible operating modes

Additional Information

1. Switch point mode When A1 < A2, both switch outputs are activated as



A 2 (N.O.) Switch output 2 When A1 > A2, both switch outputs are activated as


N.C. contacts. A 1 (N.C.) Switch output 1

A2 (N.C.) Switch output 2

2. Window mode To exchange the switching distances is of no effect.

A 1 (N.O.) Switch output 1 A2 (N.C.) Switch output 2 3. Latching mode

To exchange the switching distances is of no effect.



Release date: 2014-08-11 14:51 Date of issue: 2014-08-11 102157_eng.xml

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com



Accessories

BF 30

Mounting flange, 30 mm

BF 30-F

Mounting flange with dead stop, 30 mm

BF 5-30

Universal mounting bracket for cylindrical sensors with a diameter of 5 ... 30 mm

UVW90-M30

Ultrasonic -deflector

UVW90-K30

Ultrasonic -deflector

UC-30GM-PROG

ULTRA3000 Software for ultrasonic sensors, comfort line

UC-30GM-R2

V15-W-2M-PUR

Female cordset, M12, 5-pin, PUR cable

V15-G-2M-PVC Female cordset, M12, 5-pin, PVC cable

Description of Sensor Functions

Programming procedure

The sensor features 2 programmable switch outputs with programmable switch points. Programming the switch points and the operating mode is done either via the sensors RS232 interface and the ULTRA 3000 software (see the ULTRA 3000 software description) or by means of the programming plug at the sensors rear end which is described here.

Programming switch points 1 and 2

- 1. Disconnect supply voltage
- 2. Remove the programming plug to activate program mode.
- 3. Reconnect supply voltage (Reset)
- 4. Place the target at the desired switch point position for A1
- 5. Momentarily insert the programming plug in position A1 and then remove. This will program the switch point A1.
- 6. Place the target at the desired switch point position for A2
- 7. Momentarily insert the programming plug in position A2 and then remove. This will program the switch point A2.

Notes:

- · Removing the programming plug saves the new switch point position into the device memory.
- The programming status is indicated by the LED. A flashing green LED indicates that the target is detected; a flashing red LED indicates that no target is detected.

Programming the operation mode

If the program mode is still activated, continue at number 4. If not, activate program mode by performing the sequence numbers 1 to 3.

- 1. Disconnect supply voltage
- 2. Remove the programming plug to activate program mode.
- 3. Reconnect supply voltage (Reset)
- 4. Insert the programming plug in position E2/E3. By removing and reinserting the plug, the user can toggle through the three different modes of operation. The selected mode is indicated by the LEDs as shown below:
 - Switch point mode, LED A1 flashes
 - Window mode, LED A2 flashes
 - · Latching mode, LEDs A1 and A2 flash
- 5. Once the desired mode is selected, insert the programming plug in position T. This completes the programming procedure and saves the switch points and mode of operation.
- 6. The sensor now operates in normal mode.

Note:

102157_eng.xml

Date of issue: 2014-08-11

Release date: 2014-08-11 14:51

The programming plug also functions as the temperature compensation. If the programming plug has not been inserted in the T position within 5 minutes, the sensor will return to normal operating mode with the latest saved values, without temperature compensation.

Factory settings

See technical data.

Display

www.pepperl-fuchs.com

The sensor provides LEDs to indicate various conditions.


Refer to "General Notes Relating to Pepperl+Fuchs Product Information" Pepperl+Fuchs Group

USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com


Germany: +49 621 776 4411 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.co





| | Green LED | Red LED | Yellow LED A1 | Yellow LED A2 |
|---|------------------|-----------------------|----------------|--|
| During Normal Operation - Temperature compensated - with removed programming plug Interference (e.g. compressed air) | On Off Off | Off On Flashing | | Switching state A2 Switching state A2 remains in previ- ous state |
| During Sensor Programming | | | | |
| Switch point A1: | | | | |
| Object detected | Flashing | Off | Flashing | Off |
| No object detected | Off | Flashing | Flashing | Off |
| Switch Point A2: | | _ | - | |
| Object detected | Flashing | Off | Off | Flashing |
| No object detected | Off | Flashing | Off | Flashing |
| Operation mode: | | _ | | - |
| Switch point mode | On | Off | Flashing | Off |
| Window mode | On | Off | Off | Flashing |
| Latching mode | On | Off | Flashing | Flashing |
| Standby | Flashing | Off | previous state | previous state |



Synchronization

This sensor features a synchronization input for suppressing ultrasonic mutual interference ("cross talk"). If this input is not connected, the sensor will operate using internally generated clock pulses. It can be synchronized by applying an external square wave. The pulse duration must be \geq 100 µs. Each falling edge of the synchronization pulse triggers transmission of a single ultrasonic pulse. If the synchronization signal remains low for \geq 1 second, the sensor will revert to normal operating mode. Normal operating mode can also be activated by opening the signal connection to the synchronization input (see note below).

If the synchronization input goes to a high level for > 1 second, the sensor will switch to standby mode, indicated by the green LED. In this mode, the outputs will remain in the last valid output state.

Note:

If the option for synchronization is not used, the synchronization input has to be connected to ground (0 V) or the sensor must be operated via a V1 cordset (4-pin).

The synchronization function cannot be activated during programming mode and vice versa.

The following synchronization modes are possible:

- 1. Several sensors (max. number see technical data) can be synchronized together by interconnecting their respective synchronization inputs. In this case, each sensor alternately transmits ultrasonic pulses in a self multiplexing mode. No two sensors will transmit pulses at the same time (see note below).
- 2. Multiple sensors can be controlled by the same external synchronization signal. In this mode the sensors are triggered in parallel and are synchronized by a common external synchronization pulse.
- 3. A separate synchronization pulse can be sent to each individual sensor. In this mode the sensors operate in external multiplex mode (see note below).
- 4. A high level (+U_B) on the synchronization input switches the sensor to standby mode.

Note:

102157_eng.xml

Date of issue: 2014-08-11

Release date: 2014-08-11 14:51

Sensor response times will increase proportionally to the number of sensors that are in the synchronization string. This is a result of the multiplexing of the ultrasonic transmit and receive signal and the resulting increase in the measurement cycle time.

Note on communication with the UC-30GM-R2 interface cable

The UC-30GM-R2 interface cable allows for communication with the ultrasonic sensor using ULTRA3000 software. The cable creates a connection between a PC RS-232 interface and the programming plug socket on the sensor. When connecting to the sensor, make certain the plug is lined up correctly; otherwise no communication will be possible. The key of the cable's plug must be aligned to the groove of the socket on the sensor (not with the arrow symbol on the sensor).

Programmable parameters with the ULTRA3000 software

- Switch point 1 and 2
- NO/NC function
- Operation mode
- Sonic speed
- Temperature offset (The inherent temperature-rise of the sensor can be considered in the temperature compensation)
- Expansion of the unusable area (for suppression of unusable area echoes)
- Reduction of the detection range (for suppression of remote range echoes)
- Time of measuring cycle
- · Acoustic power (interference of the burst duration)
- Sensitivity
- Behaviour of the sensor in case of echo loss
- Behaviour of the sensor in case of a fault
- Average formation via an allowed number of measuring cycles
- On/off-delay

www.pepperl-fuchs.com


- Switching hysteresis
- Selection of the parameter set, RS 232 or manually

fa-info@us.pepperl-fuchs.com

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"
Pepperl+Fuchs Group
USA: +1 330 486 0001
G

Germany: +49 621 776 4411 fa-info@de.pepperl-fuchs.com Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com







Note:

When connected to a PC and running the ULTRA3000 software, the sensor can act as a long term data logger as well.

 Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

 Pepperl+Fuchs Group
 USA: +1 330 486 0001
 G

 www.pepperl-fuchs.com
 fa-info@us.pepperl-fuchs.com
 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 4411 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com



5