

Technical data sheet · Fittings for C-track cables RB

Cable fittings and accessories



Identification	Type	RB PG 29
	Part-No.	600306
Use/Area of application		
Properties	<ul style="list-style-type: none">• Cable fitting with hexagon base• Strain relief through strain relief ferrule• Seal and O-Ring• With the Lütze-RB fittings and SUPERFLEX-cables the risk of a wire break on frequently moving machine parts is virtually eliminated• Application: Slide the upper part of the RB fittings onto the control cable. Screw in the lower part of the RB fittings into the machine part or the enclosure and tighten. Subsequently remove the control cable jacket and strip the insulation and screw on the upper part of the RB fitting onto the lower part and tighten. Fix the outer end of the strain relief ferrule with a cable tie.	
Technical data		
Strain relief	Yes	
Material	Brass nickel-plated	
Protection class	IP 65	
SW	40 mm	
Gasket	Neoprene	
O-Ring (OR)	Perbunan®	
Clamping range D	14.0 – 21.0 mm	
Strain relief ferrule	Stainless steel	
weight approx.	14.05 kg/100 piece	

24.11.2007 – Subject to technical modification

Part-No. 600306

USA: LUTZE INC.

13330 South Ridge Drive • Charlotte, NC 28273
Tel.: +1 (704) 504-0222 • Fax: +1 (704) 504-0223
www.lutze.com • info@lutze.com

United Kingdom: LÜTZE Ltd.

Unit 3 Sandy Hill Park
Sandy Way, Amington • GB-Tamworth, Staffs, B77 4DU
Tel.: +44 (0)1827 31333-0 • Fax: +44 (0)1827 31333-2
www.lutze.com • sales.gb@lutze.co.uk

Technical data sheet · Fittings for C-track cables RB

Thread PG 29

Design

G	PG 29
L 1	10.0 mm
L	38.0 mm
SW	40 mm

General

PU 1 piece

Note With the Lütze-RB fittings and SUPERFLEX-cables the risk of a wire break on frequently moving machine parts is virtually eliminated.

Application


Slide the upper part of the RB fittings onto the control cable.

Screw in the lower part of the RB fittings into the machine part or the enclosure and tighten.

Subsequently remove the control cable jacket and strip the insulation and screw on the upper part of the RB fitting onto the lower part and tighten.

Fix the outer end of the strain relief ferrule with a cable tie.

Dimensions

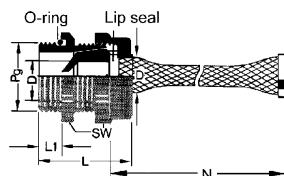

24.11.2007 – Subject to technical modification

Part-No. 600306

USA: LUTZE INC.

13330 South Ridge Drive • Charlotte, NC 28273
Tel.: +1 (704) 504-0222 • Fax: +1 (704) 504-0223
www.lutze.com • info@lutze.com

United Kingdom: LÜTZE Ltd.

Unit 3 Sandy Hill Park
Sandy Way, Amington • GB-Tamworth, Staffs, B77 4DU
Tel.: +44 (0)1827 31333-0 • Fax: +44 (0)1827 31333-2
www.lutze.com • sales.gb@lutze.co.uk