Motor feedback systems rotary HIPERFACE® SRS/SRM50

SRM50-HGV0-K21







 Model Name
 > SRM50-HGV0-K21

 Part No.
 > 1037081



## At a glance

- · Motor feedback systems for the top performance range
- 1,024 sine/ cosine periods per revolution
- Absolute position with a resolution of 32,768 increments per revolution and 4,096 revolutions with the multiturn system
- HIPERFACE® interface: Programming of the position value and electronic type label
- · Insert shaft or tapered shaft with various torque supports
- Integrated version, mounted version or stand-alone design
- Certified according to SIL2/PL d (only valid for SRS50S/SRM50S...)
- · Conforms to RoHs

## Your benefits

- Motor feedback system with HIPERFACE® interface
- High shock/vibration resistance thanks to built-in metal code disk
- · Consistent motor design due to identical size of single and multiturn design
- To use of a motor feedback system certified to SIL2/PL d makes it easier to have your system certified.
- · Very smooth running thanks to maximum ball bearing distance



## Performance

Number of sine/cosine periods per revolution:	1,024
Number of the absolute ascertainable revolutions:	4,096 (Multiturn)
Total number of steps:	134,217,728
Measuring step:	0.3 angular seconds at interpolation of the sine/cosine signals with e.g. 12 Bit
Differential non-linearity:	± 7 angular seconds (Non-linearity within a sine/cosine period)
Operating speed:	6,000 /min, up to which the absolute position can be reliably produced
Available memory area:	128 Byte, 128 Byte (E2PROM 512)
Integral non-linearity typ.:	± 45 angular seconds (Error limits for evaluating sine/cosine period) without mechanical tension of the stator coupling
Mechanical data	


moonamoar aata	
Flange type/stator coupling:	Resolver support
Dimensions:	See dimensional drawing
Moment of inertia of the rotor:	10 gcm <sup>2</sup>
Maximum operating speed:	12,000 /min
Maximum angular acceleration:	200,000 rad/s <sup>2</sup>

Operating torque:	0.2 Ncm
Start up torque:	0.4 Ncm
Permissible shaft movement, radial, static:	± 0.25 mm
Permissible shaft movement, radial, dynamic:	± 0.1 mm
Permissible shaft movement, axial, static:	± 0.75 mm
Permissible shaft movement, axial, dynamic:	± 0.2 mm
Life of ball bearings:	3.6 x 10^9 revolutions
Connection type:	Cable, 8-pin, radial, 200 mm
Shaft version:	Tapered shaft
Angular motion perpendicular to the rotational axis, static:	± 0.005 mm/mm
Angular motion perpendicular to the rotational axis, dynamic:	± 0.002 mm/mm
GEWICHT01:	0.2 kg
Electrical data	
Electrical interface:	HIPERFACE
Operating voltage range/supply Voltage:	7 V DC 12 V DC
Recommended supply voltage:	8 V DC
Recommended supply voltage: Output frequency for sine/cosine signals:	0 kHz 200 kHz
Output frequency for sine/cosine signals:	0 kHz 200 kHz
Output frequency for sine/cosine signals: Operating power consumption (no load):	0 kHz 200 kHz
Output frequency for sine/cosine signals: Operating power consumption (no load): <sup>1)</sup> Without load	0 kHz 200 kHz
Output frequency for sine/cosine signals: Operating power consumption (no load): <sup>1)</sup> Without load Interfaces	0 kHz 200 kHz 80 mA <sup>1)</sup>
Output frequency for sine/cosine signals: Operating power consumption (no load): <sup>1)</sup> Without load Interfaces Type of code for the absolute value:	0 kHz 200 kHz 80 mA <sup>1)</sup> Binary Increasing, for clockwise shaft rotation, looking in direction "A" (see
Output frequency for sine/cosine signals: Operating power consumption (no load): <sup>1)</sup> Without load Interfaces Type of code for the absolute value: Code sequence: Interface signals:	0 kHz 200 kHz 80 mA <sup>1)</sup> Binary Increasing, for clockwise shaft rotation, looking in direction "A" (see dimensional drawing) Parameter channel RS 485: digital, Process data channel SIN, REFSIN
Output frequency for sine/cosine signals: Operating power consumption (no load): <sup>1)</sup> Without load Interfaces Type of code for the absolute value: Code sequence: Interface signals:	0 kHz 200 kHz 80 mA <sup>1)</sup> Binary Increasing, for clockwise shaft rotation, looking in direction "A" (see dimensional drawing) Parameter channel RS 485: digital, Process data channel SIN, REFSIN
Output frequency for sine/cosine signals: Operating power consumption (no load): <sup>1)</sup> Without load Interfaces Type of code for the absolute value: Code sequence: Interface signals: Ambient data	0 kHz 200 kHz 80 mA <sup>1)</sup> Binary Increasing, for clockwise shaft rotation, looking in direction "A" (see dimensional drawing) Parameter channel RS 485: digital, Process data channel SIN, REFSIN COS, REFCOS: analog, differential
Output frequency for sine/cosine signals: Operating power consumption (no load): <sup>1)</sup> Without load Interfaces Type of code for the absolute value: Code sequence: Interface signals: <b>Ambient data</b> Working temperature range:	0 kHz 200 kHz 80 mA <sup>1)</sup> Binary Increasing, for clockwise shaft rotation, looking in direction "A" (see dimensional drawing) Parameter channel RS 485: digital, Process data channel SIN, REFSIN COS, REFCOS: analog, differential
Output frequency for sine/cosine signals: Operating power consumption (no load): <sup>1)</sup> Without load Interfaces Type of code for the absolute value: Code sequence: Interface signals: <b>Ambient data</b> Working temperature range: Storage temperature range:	0 kHz 200 kHz 80 mA <sup>1)</sup> Binary Increasing, for clockwise shaft rotation, looking in direction "A" (see dimensional drawing) Parameter channel RS 485: digital, Process data channel SIN, REFSIN COS, REFCOS: analog, differential -30 °C +115 °C -40 °C +125 °C, without package
Output frequency for sine/cosine signals: Operating power consumption (no load): <sup>1)</sup> Without load Interfaces Type of code for the absolute value: Code sequence: Interface signals: <b>Ambient data</b> Working temperature range: Storage temperature range: Relative humidity/Condensation:	0 kHz 200 kHz 80 mA <sup>1)</sup> Binary Increasing, for clockwise shaft rotation, looking in direction "A" (see dimensional drawing) Parameter channel RS 485: digital, Process data channel SIN, REFSIN COS, REFCOS: analog, differential -30 °C +115 °C -40 °C +125 °C, without package 90 %, Condensation not permitted 100 g/10 ms/according to EN 60068-2-27 20 g/10 Hz/2,000 Hz/according to EN 60068-2-6
Output frequency for sine/cosine signals: Operating power consumption (no load): <sup>1)</sup> Without load Interfaces Type of code for the absolute value: Code sequence: Interface signals: Ambient data Working temperature range: Storage temperature range: Relative humidity/Condensation: Resistance to shocks:	0 kHz 200 kHz 80 mA <sup>1)</sup> Binary Increasing, for clockwise shaft rotation, looking in direction "A" (see dimensional drawing) Parameter channel RS 485: digital, Process data channel SIN, REFSIN COS, REFCOS: analog, differential -30 °C +115 °C -40 °C +125 °C, without package 90 %, Condensation not permitted 100 g/10 ms/according to EN 60068-2-27

central earthing point of the motor controller via a cable screen. This is also where the GND (0 V) connection of the power supply voltage is linked to earth. Users must

perform their own tests when other screen designs are used.

# **Dimensional drawing**

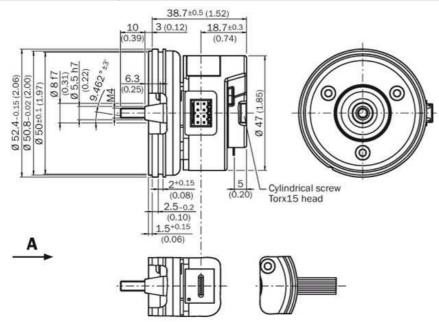

### Australia

Phone +61 3 9457 0600 1800 33 48 02 - tollfree E-Mail sales@sick.com.au

Belgium/Luxembourg Phone +32 (0)2 466 55 66 E-Mail info@sick.be

Brasil Phone +55 11 3215-4900 E-Mail marketing@sick.com.br

#### Canada

Phone +1 905 771 14 44 E-Mail information@sick.com

Česká republika Phone +420 2 57 91 18 50 E-Mail sick@sick.cz

### China

Phone +86 4000 121 000 E-Mail info.china@sick.net.cn Phone +852-2153 6300 E-Mail ghk@sick.com.hk

Danmark Phone +45 45 82 64 00 E-Mail sick@sick.dk

Deutschland Phone +49 211 5301-301 E-Mail info@sick.de

España Phone +34 93 480 31 00 E-Mail info@sick.es

France Phone +33 1 64 62 35 00 E-Mail info@sick.fr

Great Britain Phone +44 (0)1727 831121 E-Mail info@sick.co.uk

India Phone +91-22-4033 8333 E-Mail info@sick-india.com

Israel Phone +972-4-6881000 E-Mail info@sick-sensors.com Italia

Phone +39 02 27 43 41 E-Mail info@sick.it

Japan Phone +81 (0)3 5309 2112 E-Mail support@sick.jp

Magyarország Phone +36 1 371 2680 E-Mail office@sick.hu

Nederland Phone +31 (0)30 229 25 44 E-Mail info@sick.nl E-Mail sick@sick.no Österreich Phone +43 (0)22 36 62 28 8-0 E-Mail office@sick.at Polska Phone +48 22 837 40 50

Phone +47 67 81 50 00

Norge

E-Mail info@sick.pl România

Phone +40 356 171 120 E-Mail office@sick.ro Russia

Phone +7-495-775-05-30 E-Mail info@sick.ru

Schweiz Phone +41 41 619 29 39 E-Mail contact@sick.ch

Singapore Phone +65 6744 3732 E-Mail sales.gsg@sick.com

Slovenija Phone +386 (0)1-47 69 990 E-Mail office@sick.si

South Africa Phone +27 11 472 3733

E-Mail info@sickautomation.co.za
South Korea

Phone +82 2 786 6321/4 E-Mail info@sickkorea.net

Suomi Phone +358-9-25 15 800 E-Mail sick@sick.fi

Sverige Phone +46 10 110 10 00 E-Mail info@sick.se

Taiwan Phone +886 2 2375-6288 E-Mail sales@sick.com.tw

Türkiye Phone +90 (216) 528 50 00 E-Mail info@sick.com.tr

United Arab Emirates Phone +971 (0) 4 88 65 878 E-Mail info@sick.ae

USA/México Phone +1(952) 941-6780 1 (800) 325-7425 - tollfree E-Mail info@sickusa.com

More representatives and agencies at www.sick.com

