Motor feedback systems rotary incremental with commutation CFS50

CFS50-AFV02X04







 Model Name
 > CFS50-AFV02X04

 Part No.
 > 1065222



Illustration may differ

At a glance

- Output driver for incremental and commutation signals as per EIA 422
- · Resolution of up to 65,536 lines per revolution
- · Commutation signals up to 32 pole pairs
- Temperature range from -20 °C to +115 °C
- Various mechanical interfaces

Your benefits

- High level of flexibility due to mechanics already proven in other motor feedback systems
- · High level of compatibility thanks to standard interface
- · Time-saving due to electrical zero adjustment

Performance

Number of lines per revolution:	2,000 ¹⁾
Measuring step:	90 ° /number of lines
Commutation signals:	4 pole pairs
Reference signal, number:	1
Reference signal, position:	90 ° electronically, gated with A and B
Operating speed:	6,000 /min

¹⁾ Number of lines from 1 ... 1.000 and > 4.096 ... 65.536 on request


Mechanical data

Shaft version:	Tapered shaft
Flange type/stator coupling:	Spring mounting plate
Dimensions:	See dimensional drawing
Mass:	0.1 kg
Moment of inertia of the rotor:	10 gcm ²
Maximum operating speed:	12,000 /min
Maximum angular acceleration:	200,000 rad/s ²
Operating torque:	0.2 Ncm
Start up torque:	0.4 Ncm
Permissible shaft movement, radial, static:	± 0.5 mm
Permissible shaft movement, radial, dynamic:	± 0.1 mm
Permissible shaft movement, axial, static:	± 0.75 mm
Permissible shaft movement, axial, dynamic:	± 0.2 mm
Life of ball bearings:	3.6 x 10 [^] 9 revolutions

Connection type:	Stranded cable, 15-pin, radial
Angular motion perpendicular to the rotational axis, static:	± 0.005 mm/mm
Angular motion perpendicular to the rotational axis, dynamic:	± 0.002 mm/mm
Electrical data	
Electrical interface:	TTL/RS422
Operating voltage range/supply Voltage:	4.5 V DC 5.5 V DC
Maximum output frequency:	820 kHz
Operating power consumption (no load):	60 mA ¹⁾
¹⁾ Without load	
Without load	
Without load	
Ambient data	
	-20 °C 115 °C
Ambient data	-20 °C 115 °C -40 °C 125 °C, without package
Ambient data Working temperature range:	
Ambient data Working temperature range: Storage temperature range:	-40 °C 125 °C, without package
Ambient data Working temperature range: Storage temperature range: Relative humidity/Condensation:	-40 °C 125 °C, without package 90 %, Condensation not permitted 100 g/10 ms/according to EN 60068-2-27
Ambient data Working temperature range: Storage temperature range: Relative humidity/Condensation: Resistance to shocks:	-40 °C 125 °C, without package 90 %, Condensation not permitted
Ambient dataWorking temperature range:Storage temperature range:Relative humidity/Condensation:Resistance to shocks:Resistance to vibration:EMC:	-40 °C 125 °C, without package 90 %, Condensation not permitted 100 g/10 ms/according to EN 60068-2-27 20 g/10 Hz/2,000 Hz/according to EN 60068-2-6
Ambient data Working temperature range: Storage temperature range: Relative humidity/Condensation: Resistance to shocks: Resistance to vibration: EMC: Enclosure rating:	-40 °C 125 °C, without package 90 %, Condensation not permitted 100 g/10 ms/according to EN 60068-2-27 20 g/10 Hz/2,000 Hz/according to EN 60068-2-6 (according to EN 61000-6-2 and EN 61000-6-3) ¹⁾ IP 40 (according to IEC 60529)
Ambient data Working temperature range: Storage temperature range: Relative humidity/Condensation: Resistance to shocks: Resistance to vibration: EMC: Enclosure rating:	-40 °C 125 °C, without package 90 %, Condensation not permitted 100 g/10 ms/according to EN 60068-2-27 20 g/10 Hz/2,000 Hz/according to EN 60068-2-6 (according to EN 61000-6-2 and EN 61000-6-3) ¹⁾


perform their own tests when other screen designs are used.

Dimensional drawing

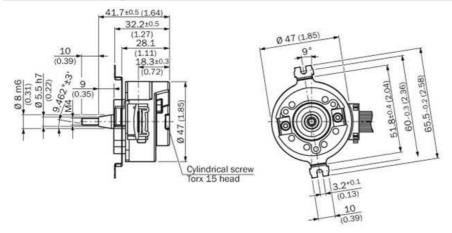

All dimensions in mm (inch)

Incremental track

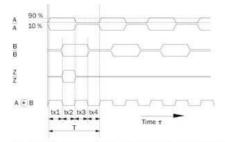

At constant rotational speed with regard to the input shaft and rotation in clockwise direction.


By connecting the two signals A and B, an output signal arises whose period durations tx1 ... tx4 have varying lengths.

The differences are determined:

- · by the pulse/pause ratio tolerance of the individual channels
- by the tolerance in the 90° phase shift between A and B
- · by the frequency

The times $tx1 \dots tx4$ ideally have to amount to 1/4 of the particular period duration T. The typical output frequency of the encoder is defined so that the max. time tx is smaller than 1.5 x T/4.

Pulse time diagram

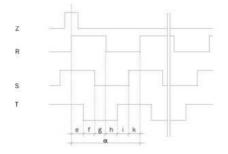

Polpairs	Number of poles	e, f, g, h, i, k	a	
2	4	30*	180*	
3	6	20*	120*	
4	8	15*	90*	
6	12	10*	60*	
8	16	7.5*	45*	

The angle information is related to a mechanical shaft rotation. Fiank precision of the signals R, S, T \pm 1°.

Wire allocation

PIN	Color	Signal	
1	Blue	Ground connection (GND)	
2	Red	Supply voltage 5 V ± 10 % (Ug)	
3	Yellow	Reference signal inverted (\overline{Z})	
4	Purple	Reference signal (Z)	
Б	Brown	Increment signal inverted (Ā)	
6	White	Increment signal (A)	
7	Black	Increment signal inverted (B)	
8	Pink	Increment signal (B)	
9	White/Red	Commutation signal inverted (T)	
10	White/Gray	Commutation signal (T)	
11	White/Blue	Commutation signal inverted (\$)	
12	White/Yellow	Commutation signal (S)	
13	White/Pink	Commutation signal inverted (R)	
14	White/Green	Commutation signal (R)	
15	Gray	Electronic setting of the commutation signals (SET0)	

Australia

Phone +61 3 9457 0600 1800 33 48 02 - tollfree E-Mail sales@sick.com.au

Belgium/Luxembourg Phone +32 (0)2 466 55 66 E-Mail info@sick.be

Brasil Phone +55 11 3215-4900 E-Mail marketing@sick.com.br

Canada

Phone +1 905 771 14 44 E-Mail information@sick.com

Česká republika Phone +420 2 57 91 18 50 E-Mail sick@sick.cz

China

Phone +86 4000 121 000 E-Mail info.china@sick.net.cn Phone +852-2153 6300 E-Mail ghk@sick.com.hk

Danmark Phone +45 45 82 64 00 E-Mail sick@sick.dk

Deutschland Phone +49 211 5301-301 E-Mail info@sick.de

España Phone +34 93 480 31 00 E-Mail info@sick.es

France Phone +33 1 64 62 35 00 E-Mail info@sick.fr

Great Britain Phone +44 (0)1727 831121 E-Mail info@sick.co.uk

India Phone +91-22-4033 8333 E-Mail info@sick-india.com

Israel Phone +972-4-6881000 E-Mail info@sick-sensors.com Italia

Phone +39 02 27 43 41 E-Mail info@sick.it

Japan Phone +81 (0)3 5309 2112 E-Mail support@sick.jp

Magyarország Phone +36 1 371 2680 E-Mail office@sick.hu

Nederland Phone +31 (0)30 229 25 44 E-Mail info@sick.nl E-Mail sick@sick.no Österreich Phone +43 (0)22 36 62 28 8-0 E-Mail office@sick.at Polska Phone +48 22 837 40 50

Phone +47 67 81 50 00

Norge

E-Mail info@sick.pl România

Phone +40 356 171 120 E-Mail office@sick.ro Russia

Phone +7-495-775-05-30 E-Mail info@sick.ru

Schweiz Phone +41 41 619 29 39 E-Mail contact@sick.ch

Singapore Phone +65 6744 3732 E-Mail sales.gsg@sick.com

Slovenija Phone +386 (0)1-47 69 990 E-Mail office@sick.si

South Africa Phone +27 11 472 3733

E-Mail info@sickautomation.co.za
South Korea

Phone +82 2 786 6321/4 E-Mail info@sickkorea.net

Suomi Phone +358-9-25 15 800 E-Mail sick@sick.fi

Sverige Phone +46 10 110 10 00 E-Mail info@sick.se

Taiwan Phone +886 2 2375-6288 E-Mail sales@sick.com.tw

Türkiye Phone +90 (216) 528 50 00 E-Mail info@sick.com.tr

United Arab Emirates Phone +971 (0) 4 88 65 878 E-Mail info@sick.ae

USA/México Phone +1(952) 941-6780 1 (800) 325-7425 - tollfree E-Mail info@sickusa.com

More representatives and agencies at www.sick.com

