

Features

- 1-channel isolated barrier
- 24 V DC supply (loop powered)
- 2- or 3-wire Pt100 RTD input
- Output 4 mA ... 20 mA, temperature linearization selectable
- DIP switch selectable ranges
- Sensor breakage detection


Function

This isolated barrier is used for intrinsic safety applications. It is a loop-powered isolator that converts the resistance from a 3-wire RTD in the hazardous area to a 4 mA ... 20 mA signal in the safe area.


A selectable analog linearization ensures a temperature linear 4 mA ... 20 mA output between 25 °C ... 375 °C.

It also features conveniently located DIP switches, rotary switches and potentiometers to make field calibration easy.

Assembly

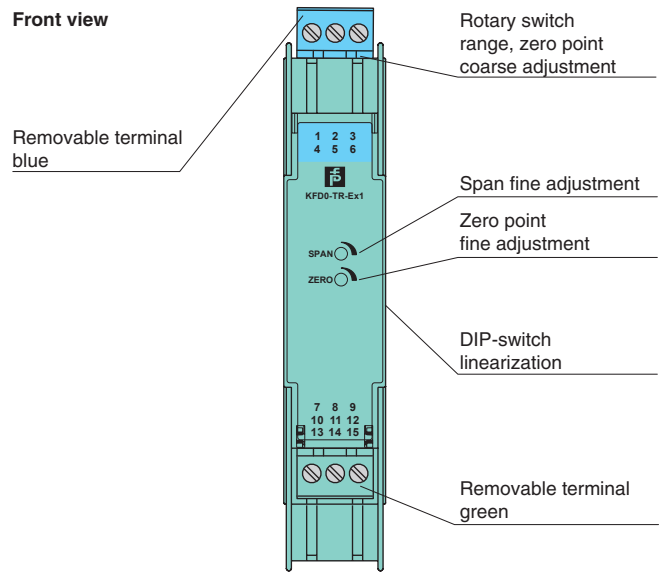

Connection

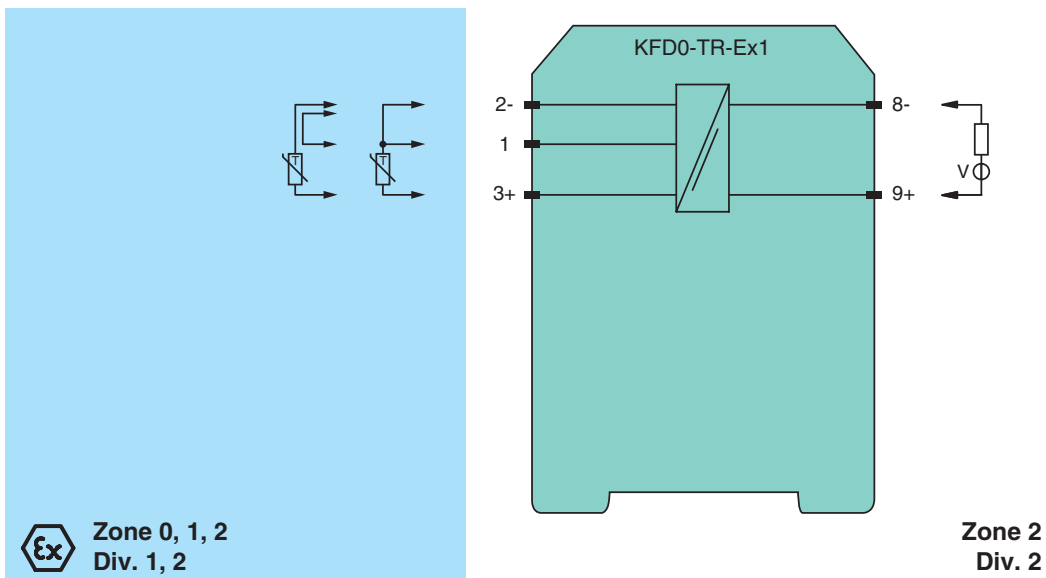

Release date 2010-02-02 14:10 Date of issue 2015-02-16 043691_eng.xml



Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

Pepperl+Fuchs Group
www.pepperl-fuchs.com

USA: +1 330 486 0002
pa-info@us.pepperl-fuchs.com

Germany: +49 621 776 2222
pa-info@de.pepperl-fuchs.com


Singapore: +65 6779 9091
pa-info@sg.pepperl-fuchs.com

General specifications		
Signal type		Analog input
Supply		
Rated voltage	U_n	12 ... 35 V DC loop powered
Power loss		0.4 W
Input		
Connection		terminals 1, 2-, 3+ suitable for Pt100, 2- and 3-wire connection
Lead resistance		≤ 100 Ω per lead
Measuring current		approx. 1 mA
Output		
Connection		terminals 9+, 8-
Load		(U -12 V) / 0.02 A
Current output		4 ... 20 mA , limited to ≤ 35 mA
Fault signal		upscaling ≥ 22 mA (limited to 35 mA)
Transfer characteristics		
Measurement range	f_n	span without linearization 25 ... 800 °C (77 ... 1472 °F)/with linearization 25 ... 375 °C (77 ... 707 °F), both adjustable zero point without linearization -200 ... 400 °C (-328 ... 752 °F)/with linearization -30 ... 375 °C (-22 ... 707 °F), both adjustable
Deviation		
After calibration		0.1 % of full-scale value incl. linearity and hysteresis
Influence of ambient temperature		span and zero point 0.015 % / K or ± 10 mΩ / K
Influence of supply voltage		6.5 ppm/V
Rise time		250 ms
Electrical isolation		
Input/Output		available
Directive conformity		
Electromagnetic compatibility		
Directive 2004/108/EC		EN 61326-1:2006
Conformity		
Insulation coordination		EN 50178
Electrical isolation		EN 50178
Electromagnetic compatibility		NE 21
Degree of protection		IEC 60529
Ambient conditions		
Ambient temperature		-20 ... 60 °C (-4 ... 140 °F)
Mechanical specifications		
Degree of protection		IP20
Mass		approx. 150 g
Dimensions		20 x 119 x 115 mm (0.8 x 4.7 x 4.5 in) , housing type B2
Data for application in connection with Ex-areas		
EC-Type Examination Certificate		ZELM 00 ATEX 0036 , for additional certificates see www.pepperl-fuchs.com
Group, category, type of protection		 II (1)GD [Ex ia] IIC
Voltage	U_o	16.1 V
Current	I_o	33 mA
Power	P_o	131 mW
Type of protection [Ex ia and Ex ib]		
Statement of conformity		TÜV 01 ATEX 1777X , observe statement of conformity
Group, category, type of protection, temperature class		 II 3G Ex nA II T4
Electrical isolation		
Input/Output		safe electrical isolation acc. to IEC/EN 60079-11, voltage peak value 375 V
Directive conformity		
Directive 94/9/EC		EN 50014, EN 50020 , EN 60079-0:2006, EN 60079-15:2005
International approvals		
CSA approval		
Control drawing		116-0132
General information		
Supplementary information		EC-Type Examination Certificate, Statement of Conformity, Declaration of Conformity, Attestation of Conformity and instructions have to be observed where applicable. For information see www.pepperl-fuchs.com .

Release date 2010-02-02 14:10 Date of issue 2015-02-16 043691_eng.xml

Configuration


DIP switches function

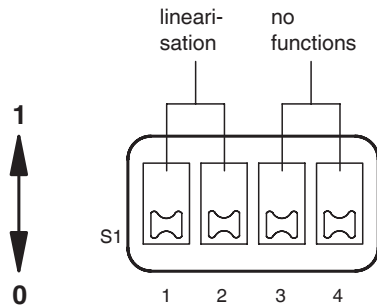

Switch	Position	Function
S1.1	1	Pt100 with linearisation
S1.2	0	(-30 °C ... 375 °C)
S1.1	0	Pt100 without linearisation
S1.2	1	(-200 °C ... 800 °C)

Other combinations of S1.1 and S1.2 are not allowed.

Rotary switches function

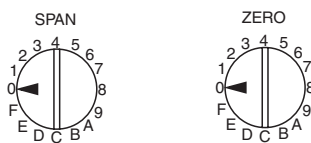

Please consider that both tables contain typical values, which can be used as an adjustment help.

Adjustment range with linearisation					
Switch SPAN (°C) coarse adjustment	D	6	2	1	0
	20 ... 60	35 ... 100	75 ... 220	120 ... 340	260 ... 375
Switch ZERO (°C) coarse adjustment					
0	-	-	-	-	-
1	-	-	-	-	-
2	-	-	-	-	-
3	-	-	-	-	-
4	-	-	-	-	-
5	-19 ... 50	-22 ... 45	-30 ... 29	-30 ... 13	-
6	35 ... 103	30 ... 97	16 ... 78	2 ... 61	-30 ... 0
7	87 ... 155	82 ... 148	65 ... 127	48 ... 107	-10 ... 38
8	142 ... 207	134 ... 200	115 ... 177	96 ... 154	28 ... 76
9	192 ... 257	185 ... 249	162 ... 223	141 ... 198	65 ... 111
A	245 ... 306	234 ... 297	209 ... 269	185 ... 242	-
B	290 ... 355	282 ... 344	254 ... 315	-	-
C	338 ... 375	329 ... 375	-	-	-
D	-	-	-	-	-
E	-	-	-	-	-
F	-	-	-	-	-

Adjustment range without linearisation					
Switch SPAN (°C) coarse adjustment	D	6	2	1	0
	25 ... 60	40 ... 100	90 ... 230	140 ... 360	320 ... 800
Switch ZERO (°C) coarse adjustment					
0	-	-	-	-	-
1	-200 ... -171	-200 ... -172	-200 ... -176	-200 ... -179	-
2	-183 ... -112	-184 ... -115	-188 ... -122	-191 ... -129	-200 ... -153
3	-126 ... -54	-127 ... -54	-134 ... -67	-140 ... -77	-163 ... -111
4	-68 ... -6	-71 ... 1	-80 ... -12	-90 ... -24	-122 ... -70
5	-9 ... 65	-14 ... 59	-26 ... 42	-38 ... 27	-80 ... -29
6	48 ... 123	43 ... 116	28 ... 97	14 ... 78	-40 ... 12
7	107 ... 182	101 ... 175	82 ... 151	65 ... 130	1 ... 53
8	168 ... 243	160 ... 234	138 ... 208	117 ... 183	43 ... 95
9	226 ... 302	217 ... 292	192 ... 262	168 ... 234	82 ... 135
A	284 ... 361	274 ... 350	246 ... 317	219 ... 285	122 ... 174
B	343 ... 400	331 ... 400	300 ... 372	270 ... 337	162 ... 215
C	-	-	353 ... 400	320 ... 388	201 ... 254
D	-	-	-	37 ... 400	241 ... 293
E	-	-	-	-	279 ... 333
F	-	-	-	-	318 ... 372

Release date 2010-02-02 14:10 Date of issue 2015-02-16 043691_eng.xml

Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

Recommendation for adjustment:

1. Span determination.
2. "Span coarse adjustment" in accordance with the table (for mode of operation "without linearisation" considering the approx. measurement range start).
3. Minimum value adjustment (in °C) at the input.
4. "Zero point coarse adjustment" to approach to 4 mA.
5. "Zero point fine adjustment" to exactly 4 mA.
6. Maximum value adjustment (in °C) at the input.
7. "Span fine adjustment" to exactly 20 mA.
8. If necessary repeat fine adjustment for 4 mA and 20 mA